



B109 USO
Fort Moore



Open Stair behind Reception 101:

1. The handrails and knee wall are below the min. required height.


B109 USO
Fort Moore

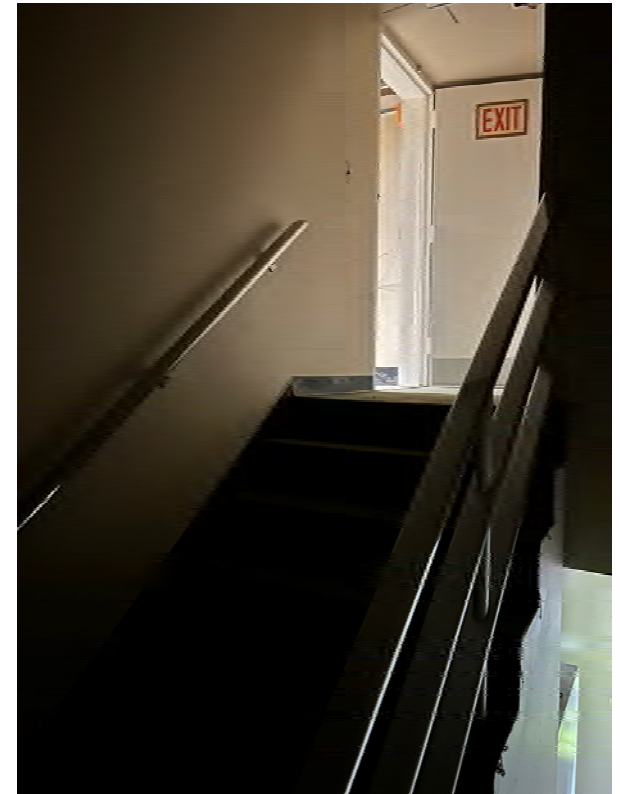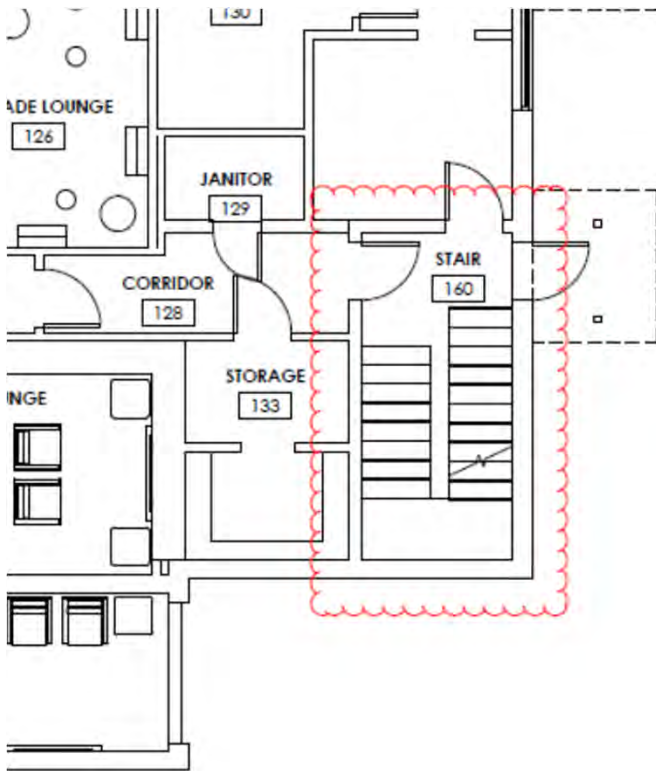

Stair 160:

1. Handrailing below the min. requirements for the overall design.
2. Neither of the entry/exit doors are labeled as fire rated.


B109 USO
Fort Moore

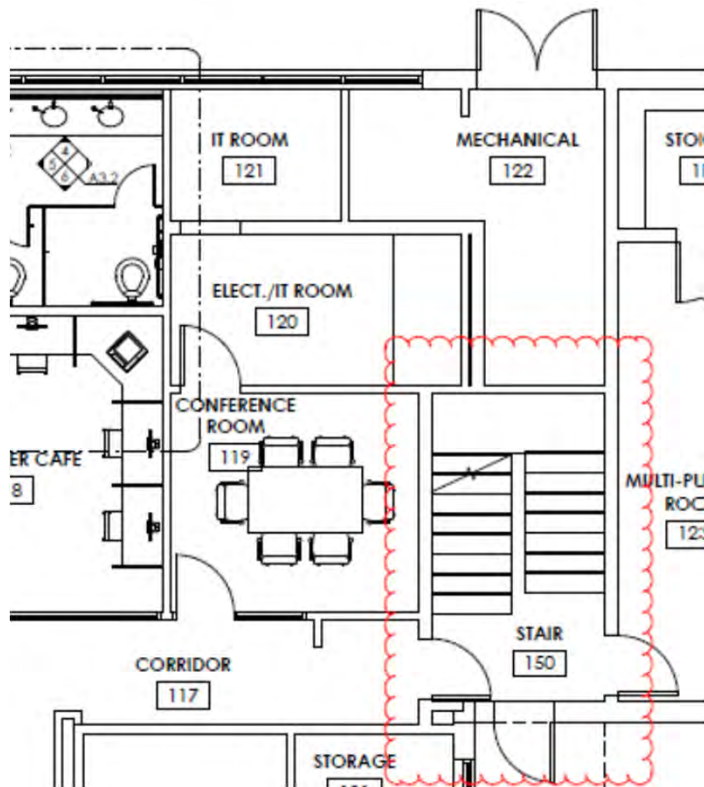

Stair 150:

1. Width of stairs are less than 36" wide
2. Handrailing below the min. required height and open guards exceed 4" allowing a 4-inch sphere to pass through.
3. A built-in custom wood cabinet was installed on the landing of the stair years ago. The landing dimensions are not compliant.
4. The top riser is 10" and the bottom riser is 3".
5. The stairwell is not fully rated 1 hour:
 - a. Neither of the entry/exit doors are labeled as fire rated. One door is wood with a vision panel at second floor.
 - b. The CMU walls do not extend to the underside of the roof decking.

B109 USO
Fort Moore

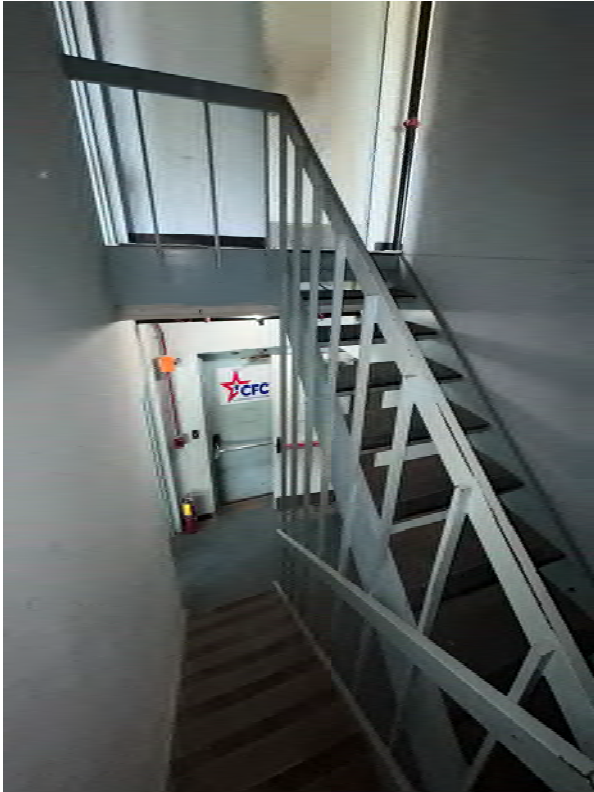

B109 USO
Fort Moore



B109 USO
Fort Moore

